# **Shawlands Conservation Area**

# **Shopfront Survey**

**FINAL DRAFT** 



Lesley Kerr, Historic Buildings Consultant May 2015

Shawlands Shopfront Survey – FINAL DRAFT

1

#### CONTENTS

#### 1.0 Introduction

- 1.1 Purpose & study area
- 1.2 Methodology

# 2.0 Survey & recommendations

- Area 1 Pollokshaws Rd from Springhill Gardens to Minard Rd
- Area 2 Pollokshaws Rd from the junction at Minard Rd./Langside Ave up to and including Shawlands Cross
- Area 3 Kilmarnock Rd. to Walton St

#### **FIGURES**

- Fig. 1 Map of Shawlands Cross Conservation Area
- Fig. 2 General views of the Conservation Area
- Fig. 3 Plan of Area 1
- Fig. 4 Area 1- priorities
- Fig. 5 Plan of Area 2
- Fig. 6 Area 2 priorities
- Fig. 7 Plan of Area 3
- Fig. 8 Area 3 priorities
- Fig. 9 Precedents

#### **USEFUL REFERENCES**

Shawlands Town Centre Action Plan, Glasgow City Council, 2012 Shawlands Conservation Area appraisal, Glasgow City Council 2013 Traditional Shopfronts, A short guide for shop owners, Historic Scotland, 2010 Scotland's Shops, Lindsay Lennie, Historic Scotland 2010

#### 1.0 INTRODUCTION

#### 1.1 Purpose and study area

This shopfront survey was commissioned by Glasgow City Heritage Trust (GCHT) for properties within the Shawlands Cross Conservation Area. The outcomes of the Shawlands Town Centre Action Plan (2012), prepared by Glasgow City Council (GCC), included working with owners to improve the appearance of shop units. This survey has been carried out to inform that process. It should be read in conjunction with the Shawlands Conservation Area Appraisal and the Action Plan.

The study area lies within the boundary of the Shawlands Cross Conservation Area (refer to map), designated in 2013. It concentrates on the commercial properties on Pollokshaws Road and Kilmarnock Road. The survey was carried out during March 2015. All images are by the author unless otherwise stated.

The aims were to identify commercial properties within buildings of architectural or historical significance, as well as those in prominent locations where improvements would have the most impact on the townscape.

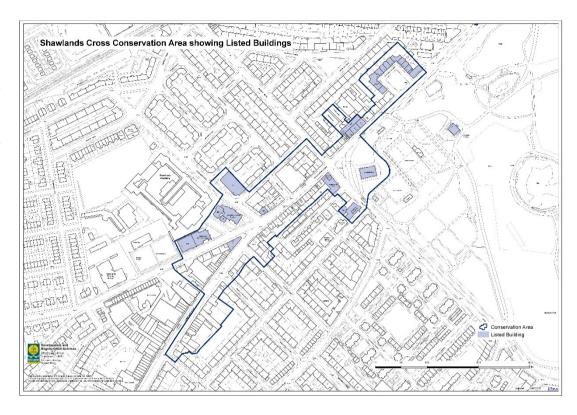


Fig 1 Shawlands Cross Conservation Area (map courtesy of GCC)

# 1.2 Methodology

The survey commenced at the north-east end of Pollokshaws Road and progressed south-west towards Shawlands Cross, and then along Kilmarnock Road. The survey information is presented in three areas as follows: Area 1 - Pollokshaws Rd from Springhill Gardens to Minard Rd; Area 2 – Pollokshaws Rd from the junction at Minard Rd./Langside Ave up to and including Shawlands Cross; Area 3 – Kilmarnock Rd. to Walton St.

A short general description of the building(s) and its significance is given, followed by a table giving a description, condition and recommendations for the shopfronts. Addresses have been taken from Ordnance Survey information and cross checked with close numbers. Most shops have no street number displayed. A selection of precedents are included at the end of the document.







Pollokshaws Rd. at Minard St. junction

Camphill Gate, Pollokshaws Rd. facing Queen's Park

Fig. 2 General views - showing the quality of the buildings and the character of the Shawlands Cross Conservation Area.



Pollokshaws Rd. looking south-west from the Gorgic towards the Cross



Shawlands Cross looking north-east



Crossmyloof Mansions, Shawlands Cross looking southwest down Kilmarnock Rd.

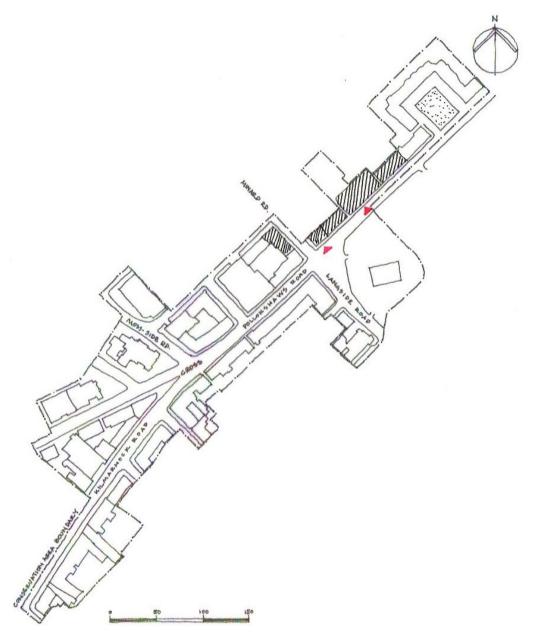


Fig. 3 SHAWLANDS CROSS CONSERVATION AREA – **Area 1** shown hatched. Arrows locate priority buildings recommended at the end of this section.

# **2.0 SURVEY** – inspection from NE to SW

The majority of buildings in the Conservation Area date from the Victorian or Edwardian periods. Their consistency of scale, material and the street pattern form the character of the area, so in this sense they are all significant. Categories of building significance below are given to assist with prioritising repairs:

High - listed building or an unlisted building of high merit, retaining original features

Medium - unlisted building of good design retaining original features and/or located in a prominent location

Low - unlisted building not in a prominent location (and perhaps in good order at time of survey)

#### AREA 1 - Pollokshaws Road - From Springhill Gardens to Minard Road (even nos.)

**Buildings:** 962-984 Pollokshaws Road (even nos)

Description: Row of 4 sandstone tenements facing the park.

Significance: Low - Unlisted buildings of merit. Part of the urban grain.

Building address	Description	Condition & observations	Recommendations
962-68 Pollokshaws Rd	Sweeney's pub- first commercial unit within the NE boundary of CA	Typical pub frontage, extends across 2 buildings of different dates, style & stone type Fair	Reduce fascia depth, remove paint or repaint darker colour (using breathable paint)
974 Pollokshaws Rd	Pend access to workshops at rear.	Nice hand-painted upholsterer's sign over pend. LH stone pier painted.	Remove paint from stonework on LHS of opening.
976-984 Pollokshaws Rd Close entry at no. 980	Good quality un-listed red sandstone tenement - good details, eg. decorative carved stone overdoor at close entrance. Replacement door very poor. 2 shopfronts existing, probably 4	No. 976 -Tanning salon with painted out windows & external roller shutter Poor	Businesses req. painted out facades have negative impact in the conservation area & should be improved or discouraged.
	originally	No.984- Letting agency with dark-painted frontage, well proportioned fascia with dental detail.	OK. In-keeping.

Building: Camphill Gate, 988-1006 Pollokshaws Rd (even nos.)

Description: 5-storey red sandstone tenement with carved decoration & flat-roofed "high-back" or drying area. Canted bay windows with turrets at each

corner. Detached, between 2 lanes giving access to workshops behind. Made up of 3 apartment blocks, each with close access at the centre and shop units either side. Shopfronts would originally have been of uniform design. Some elements of which are still visible. It would be

desirable to reinstate the original shopfront proportions, co-ordinate the signage and decoration in-keeping with a building of this quality.

Significance: High-Listed in category B. Prominent 5-storey building overlooking the park.

<b>Building address</b>	Shopfront description	Condition & observations	Recommendations
988-992	No. 988a	Elements of original shop visible (columns & line of window	Reinstate fascia of original
Pollokshaws Rd	Aluminium framed glass frontage &	cill). White fascia stands out against dark red of adjacent	proportions in uniform
Close at no. 990	modern printed signage. Deep fascia,	shop. Entrance door brought forward flush with column.	colour tones with adjacent.
2 small shops RHS,	canted profile, white background.	Black floor tiles at entrance vestibule & on stallriser.	
1 larger shop LHS	No. 988b - Timber shopfront with	Proportions of fascia & entrance door altered. Original	Retro facade is inoffensive.
	recessed entrance & original features.	features include- column with granite base, facetted profile	Colour is one of the best.
	Altered c1960 with deep fascia in	stallriser (both over painted); slender timber window frame;	Original features should be
	vertical boarding with canted profile &	terrazzo floor in entrance vestibule. Finishes & decoration	recorded & retained.
	period lettering. Replacement 1930s	extant above lowered soffit over entrance recess including-	Survey info could provide
	style door. Painted dark red.	column capital, timber detailing of fascia & entrance door	pattern for the whole
		fanlight. Roller shutter inserted in front of entrance door. In	building frontage.
		need of maintenance.	
	No. 992- larger shop LHS	No visual evidence of original features from street. Deep	Reinstate fascia of original
	Aluminium framed glass flushed	fascia with bright signage in contrasting colours. Fascia is	proportions. Any extant
	frontage with red ceramic tile finish on	twice as deep as original proportion, visible over close door	original features should be
	stallriser & line of columns.	adjacent, fixed vertically.	recorded.
994-1000	Nos. 994a & 994b- 2 flush frontages	2 similar shopfronts overlaid with contrasting signage &	As above.
Pollokshaws Rd	with painted timber (?) frames. Deep	decoration. Central column with doors either side follows	Reinstate fascia & increase
Close at no. 996	fascia with signage layered over	original symmetry. Stallriser finished in red ceramic tiles	shop window area.
2 small shops	original.	below both windows. Shopfront proportions reduced by	All to conform to a uniform
either side.		deep fascia boards & infill panel below. No.994b has further	design.
		signage on glass surface.	

	No. 998 – Aluminium framed glass	Fascia depth as original, external roller shutter fixed below.	Remove external roller
	flushed frontage. Dark grey fascia with	Entrance door relocated, stallriser removed & window	shutter. Relocate door &
	painted sign.	dropped to pavement, breaking underlying symmetry with	reinstate window
994-1000	painted sign.	shop adjacent.	
	No. 1000. Timber should restrict	• •	proportions.
Pollokshaws Rd	No. 1000 - Timber shopfront with	Similar to no. 988b. Original profiled granite stallriser below	Control signage. Reinstate
Contd.	recessed entrance & original features.	window. Other timber elements replaced, but original	original fascia & shop
	Altered c1960 with deep fascia in	details may be concealed in voids above lowered ceilings.	window proportions.
	vertical boarding with canted profile.	Window area further reduced by additional signage below	Improve window frame and
	New bright pink signage overlaid.	deep fascia.	entrance door.
1002-06	No. 1002a - external roller shutter	Dark grey fascia board in original line & proportion with	Remove external roller
Pollokshaws Rd	closed. Unit "to let".	appropriate lettering. Window area reduced at head by	shutter.
Close at no. 1004		timber panel – presumably to conceal roller	
2 shops on RHS; 1		shutter/suspended ceiling. Simple dark grey façade is in-	
shop, corner		keeping.	
display area;	No. 1002b – Newsagent. Timber	Proportions altered by increased area of signage in 3 parts,	Reinstate fascia & increase
access to hall at	shopfront with recessed entrance &	top sign over original fascia & bottom over external roller	shop window area. Control
rear on LHS	some original features.	shutter box (?). Extant original features include- column	signage on windows.
		with granite base, facetted granite stallriser (both over	
		painted); terrazzo floor in entrance vestibule.	
	No.1006 & 1006a – Flushed frontage	Unpainted ply fascia extends over entrance to hall at rear,	Replace fascia & roller
	with aluminium door & window inset	inappropriate design & crude construction. External roller	shutter as minimum
	into primary structure. Deep ply fascia.	shutter fixed over window - Very poor appearance.	improvements.
	No. 1006b – Slender Corner unit with	Depth of timber boarded fascia almost equal to height of	As above. Reduce amount
	reduced window area & recessed	window. Signage board for showroom at rear surface	of signage. Restore original
	entrance.	applied. External roller shutter below extends over adjacent	proportions in a unified
		entrance. Window cill raised. Original column extant in	design.
		corner. Some timber details extant on original line of fascia.	
		Very poor appearance.	
No 1008	Lane access to premises at rear of	Inappropriate individual signage fixed across the width of	control proliferation of
Pollokshaws Rd	Camphill Gate	lane.	signage through co-
			ordinated scheme.

Building(s): 1010-1034 Pollokshaws Rd (even nos)

Description: Three flat fronted, late 19<sup>th</sup> century, 3-storey yellow sandstone tenements. Typical of the character of the area.

Significance: Medium - All three are unlisted buildings of good quality in prominent location opposite Langside Hall. Nos.1028-34 on corner of Minard

Rd. is the most prominent.

Building address	Shopfronts	Condition	Recommendations
1010-16	No. 1010-12 – Long restaurant frontage	Well maintained frontage. Originally 2 units. Cream coloured	Co-ordinate colour scheme.
Pollokshaws Rd	with retractable canopy.	sign. Deeper than original fascia & fixed vertically.	
Close entry no.	No. 1016 – Small unit. Flat frontage	Fair-poor condition. Purple sign on fascia & silver cladding is	
1014, door is poor	with aluminium door & window inset	tired.	
	into primary structure.		
1020-26	No. 1020 – largest of 2 units. Central	Fair condition. Bright fascia signage. Window area reduced by	Reduce signage & increase
Pollokshaws Rd	entrance on flat frontage. UPVC	deeper fascia & raised cills.	window area to improve
Close entry no.	fittings.	Dark coloured decoration in-keeping with adjacent.	proportions.
1024?	No 1026 – Flat frontage. Entrance on	Fair condition. Window area reduced by deeper fascia &	
	far LHS.	additional signage below on window. Dark decoration &	
		signage in-keeping.	
1028-34	No.1028 - Flat frontage. Entrance on	Deep fascia with external roller shutter box below, reducing	3 units in prominent
Pollokshaws Rd	LHS	window height. Door & window décor different. Should read	position. Shopfront
On corner of		with no.1030 adjacent. Poor appearance.	proportions, signage &
Minard Rd.	No.1030 – Art/gift shop. Flat frontage.	Deep, horizontal boarded, unpainted fascia, concealing roller	decoration should be
Close entry no.	Painted timber frame. Entrance on RHS	shutter boxes-inappropriate. Signage & dark grey decoration-	unified. External roller
1032, fascia & 2		appropriate. Good condition. Poor proportions.	shutters should be
fanlights over	No.1034 – Corner unit. William Hill	Fair condition & appearance to Pollokshaws Rd. Returns into	removed. Hill's frontage to
door- poor	Bookmakers. Glass front to Pollokshaws	Minard Rd. where openings are blocked up. Use which	Minard Rd. could be
condition	Rd with central recessed entrance.	activates the street would be more appropriate in this	opened up. Close entry
		prominent location.	should be improved.

# AREA 1 Langside Avenue junction with Pollokshaws Road

Building(s): 5-23 Minard Road

Description: Three 4-storey, red sandstone tenements with bay-windows between Pollokshaws Rd & Frankfort St. Restaurant & café on the extreme

corners are in good order with a variety of small shops in between. The corner unit on Pollokshaws Rd (Di Maggio's entered on Pollokshaws

Rd) is most prominent. The corner unit on Frankfort St is less so but on route from Crossmyloof station. The units in between are less

prominent.

Significance: Low – Unlisted buildings of merit contributing to the character of the area.

Address	Shopfronts description	Condition	Recommendations
No.5	Residential close entry between 2	Poor condition, easily improved. Timber console bracket	Scale and style of door
	buildings. Modern door set into	detail extant.	should be improved &
	original opening.		painted.
Nos. 7-15 Minard	No.7 – Newsagent. Frontage returns	No 7 - poorest frontage of this group. Some original details	Co-ordinate signage.
Rd. Close entry	into entrance at no.5. recessed	survive. Signage covers 2/3 <sup>rd</sup> of frontage. Raised cill. External	Remove external shutter
no.11- 2 small	entrance on RHS.	roller shutter boxes midway across window. Fridges backed	boxes. Co-ordinate
units either side	No.9 – Deli. Painted frontage, recessed	against window. Condition & appearance poor.	decoration.
	entrance on LHS.	No.9 – some older details survive. Fanlight over entrance	No.7 is poorest frontage -
		blocked. In need of decoration. Appearance fair. Easily	improvements should be
		improved. Original fascia survives across whole frontage.	prioritised.
	No.13 – Wine merchant. Painted	Original fascia runs across top with signage boards of	
	frontage, recessed entrance RHS.	different sizes mounted below. No.15 has external shutter	
	No.15 –Barbers. Flat frontage.	boxes.	
Nos. 17-23 Minard	No. 17 - Solicitor's office. Blue painted	Original plain fascia visible above signage board. Signage, &	External shutter boxes
Rd. Close entry	frontage with central, recessed	shutter boxes reduce window area. Shutter boxes & signage	should be removed. In
no. 19 - 1 large	entrance & external roller shutter	over door are unsightly.	time, the original fascia
unit either side	boxes.		should be used for signage
	No.23 – corner café with flat frontage.	Signage below original fascia changes proportions. Mixed	& proportions restored.
	2 entrances, 1 off-centre & 1 at corner.	materials, all finished in dark brown. Corner detail ignores	
		curved corner above. Otherwise condition & appearance is	
		good.	

Shawlands Shopfront Survey – FINAL DRAFT

From a business c





Fascia detail @ Camphill Gate

Fig. 4 AREA 1 – Priorities

- Camphill Gate Long term aim to reinstate co-ordinated shopfronts based on original design; short term aim to record original details; control signage & remove external roller shutters; co-ordinate close entrances. Possible catalyst project.
- 1028-34 Pollokshaws Rd.- prominent site opposite Langside Hall. Short term aim to remove roller shutters and co-ordinate fascias & signage.







fascia @ 1030



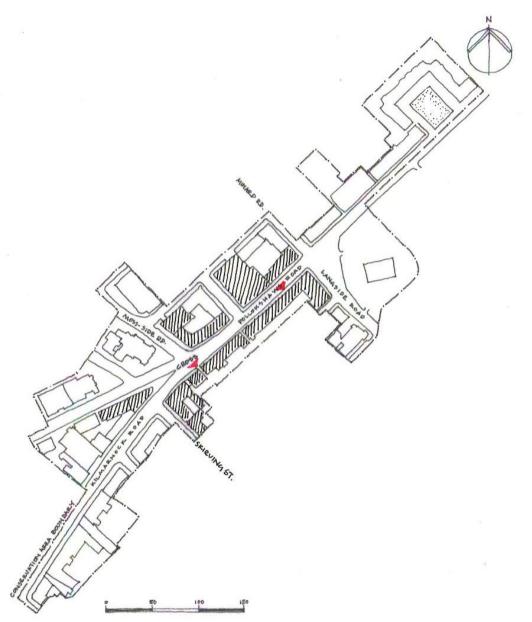


Fig. 5 SHAWLANDS CROSS CONSERVATION AREA – **Area 2** shown hatched. Arrows locate priority buildings recommended at the end of this section.

AREA 2 Pollokshaws Road from junction at Minard Rd./Langside Ave up to and including Shawlands Cross

Building(s): 1038-1050 Pollokshaws Road (even nos.)

Description: Building sits at corner with Minard Rd. 4-storey red-sandstone tenement with shallow bay windows. Corner restaurant, 3 shops units, 1

close entry and further shop unit beyond. Close entrance at 1048 has number painted on fascia and original 9-paned fanlight. A number of

satellite dishes fixed to the front façade are unsightly and detract from the general appearance of the building.

Significance: Medium - Unlisted buildings of merit contributing to the character of the area. Prominently located at junction with Langside Ave/ Minard

Rd.

<b>Building address</b>	Shopfront description	Condition	Recommendations
1038-1042	1038-40 – Di Maggio's restaurant.	Good condition. Well maintained. Retractable awnings.	Prominent corner in good
Pollokshaws Rd.	Corner unit, previously 2 shops.		order.
	1042 – Hairdresser – replacement	Deep fascia (concealing roller shutter box) with bold	Intermediate units would
	metal framed frontage.	signage. Dark grey décor. Tidy. Poor proportions.	improve from unified
1044-1050	2 units on RHS of close. 1044-	Fascias do not line through. Window area reduced by	signage and décor scheme.
Pollokshaws Rd.	Replacement aluminium framed,	shutter boxes. Signage is bold and colour schemes un-	External box shutters
Close entry no.	flushed frontage. 1046 – amusement	coordinated.	should be removed.
1048	arcade with recessed entrance.	Appearance poor.	Frontages blocked from
	1 unit on LHS of close – Bookmakers.	Signage relates to original fascia, but top lights & windows	street view should be
	Flushed frontage. White décor.	below are blocked off from view. Offers no interest to the	limited/discouraged.
		street.	

Note: The rest of this block, no. 1052 up to Abbot St., is made up of mid-20<sup>th</sup> century buildings of no distinction. Bright green Leisure centre could

improve appearance by toning down décor.

Building(s): 1082-1110 Pollokshaws Road (even nos.) at Shawlands Cross

Description:

Row of three, 4-storey red-sandstone tenements with bay windows, leading up to 5-storey, decorative former bank building at Shawlands Cross. Buildings 1082-1104 originally had uniform designed shopfronts, elements of which are extant. A simple timber cornice, with classical detail (mutule) on the soffit, a plain fascia & moulded architrave below, run the full length of the buildings. Timber console brackets in the fascia marked the ends of each unit, some are extant. Three close entrances each have a decorative cast-iron grille below the fascia displaying the street number. Close no. 1094 retains timber balusters, supported on carved brackets, either side of the metal grille. (This detail should be recorded for future reference/reproduction). Early 20<sup>th</sup> century photographs show the ground floor of 1082-88 (check) was occupied by the Co-operative Society Ltd. There was originally an entrance on the corner with Abbot Street. The details described repeated along the shopfronts, which were glazed from below the fascia with a masonry stallriser of about two feet. A continuous transom lined through with the bottom of the metal grilles. Some adjacent shop units have been combined so that there are now 6 in total, one unit either side of each close. 3 of 6 units were empty at time of survey. A number of satellite dishes fixed to the front façade are unsightly and detract from the general appearance of the building.

The 5-storey, decorative bank building at no. 1110 has a sandstone ground floor with granite base and columns at corner entrance. Openings have decorative stone carved hoods. This building addresses Shawlands Cross and has a distinctive skyline.

Significance:

High - Row of unlisted buildings of merit. Located on Shawlands Cross. Corner former bank building noted as Listed in category B.

Building address	Shopfront description	Condition	Recommendations
1082-1088	1082/4 – café -corner unit on Abbot St.	Original cornice & fascia extant. Signboards below block	3 of 6 units empty in 3
Pollokshaws Rd.	Entrance on Pollokshaws Rd. Unit	upper lights & cut across the corner. External shutter boxes	buildings.
Close entry no.	empty. Shutters closed.	fixed below further detract from appearance. White décor.	Generally - Remove
1086		Details may survive below applied boards.	external shutter boxes,
	1088 – Electrical supplies –	Signage built out over fascia with additional sign below	control signage & décor to
	replacement metal framed frontage.	(possibly shutter box). Cornice visible above. Condition is	get back to the original
		fair.	shopfront proportions &
1090-96	1090/2 –pet store- replacement	Signboard applied to fascia on canted surface. Timber	complimentary colour
Pollokshaws Rd.	minimal metal framed frontage.	console brackets extant. Glazed top lights correspond to	scheme. It would be
Close entry	Central entrance.	original transom line- Appearance & condition is fair.	desirable to expose &
no.1094	1096- boutique- replacement metal	Original cornice & fascia extant. Vertical boarding covers	repair original details.
	framed frontage with roller shutter full	fascia & architrave. Signboards below block upper lights &	
	width. (Closed on inspection).	shutter box fixed below transom line Condition fair.	
1098-1104	1100- (combined unit) vacant unit.	Signboard applied to fascia on canted surface. Extends over	
Pollokshaws Rd.	Mid-20C bold design in monochrome	close entrance. Upper lights blocked with advertising. Low	

1098-1104	stone & mosaic. No reference to	transom (shutter box?). Good quality materials. Green	1100- alter signage,
Pollokshaws Rd.	original proportions. Door on LHS.	signage is too bold. Appearance could be easily improved	unblock the upper lights &
contd.	1104-charity shop - replacement metal	Original fascia built out on canted profile and extended. Air	adopt monochrome décor.
Close entry no.	framed frontage. Door on LHS.	vents inserted. End detail of projection visible at junction	
1102		with bank building. Signboard reduces window area. White	1104-move signage onto
Prominent		décor. Proportions poor.	fascia to improve window
location.			proportions.
1110	Corner bank building on Shawlands	Building good. Applied signage on windows & on boards	Improve views to interior &
Pollokshaws Rd.	Cross. Stone façade – bar/resturant	below windows detracts from elegant appearance. Window	remove signs under
		glazing is dark. No view of interior.	windows.

**Building(s):** 12-14 Moss-side Road (even nos.)

Description: 2-storey, mid-C20 block with flat roof. 2 commercial units. 1 vacant. Blank façade to Frankfort St.

Condition: Roughcast finish, painted white. No.12 has ceramic tiled front. Fair condition.

Significance: Low – but visible. Located opposite Shawlands Cross Church, prominent in views along Pollokshaws Rd.

Comments: Co-ordinate signage & shop décor to improve appearance in prominent site.

Building(s): The Corona, 1039-1043 Pollokshaws Road (odd nos.) & 26 Langside Ave.

Description: 1-storey Corona bar occupying corner. 3-storey Marborough House occupying rest of the site. Corona now extends into the ground floor of

Marlborourgh House on Pollokshaws Rd., previously 2 shop units. Other alterations — Marlborough House cornice line lowered to suit extended Corona cornice. Lead flashing introduced above. Original fascia altered, windows as original- now painted white. Granite base is

extant but masonry has been coated with roughcast finish, painted.

Condition: Well maintained.

Significance: High - Listed in category C. Located at prominent junction with Langside Ave.

Comments: A darker/less contracting colour on window frames & architectural details would improve appearance. Non-breathable, painted roughcast

could damage substrate over time.

**Buildings:** 1045-1067 Pollokshaws Road (odd nos.)

Description: Handsome 4-storey red sandstone tenement with bay windows, originally having a decorative uniform shopfront design. A simple timber

cornice, with classical detail (mutule) on soffit and a plain fascia below, runs the full length of the building. The cornice is forward of the bay windows and forms a ledge between them. The cornice is supported by timber console brackets, originally at every unit. Three close entrances each have the original fanlight with circular astragal and moulded timber details. There were no close doors. Historical photos show the cill line of the fanlight was continued as a timber transom across the shop windows. Shop signage was on the fascia. Shopfronts were non-loadbearing, mainly glass (some curved at entrances) with fine timber frames. Structural columns were behind the glass. The shop entrances were recessed with a simple, timber fretwork panel over and all the shop doors & fanlights were the same pattern. Today

there are 8 shop units.

Significance: High- Unlisted building of high quality. Located close to junction with Langside Ave. Photographic evidence of original design (Virtual

Mitchell).

Building address	Shopfronts description	Condition	Recommendations
No.1045-51	1045 & 1049-51- One grocery/florist	Good condition & appearance. Piers have been faced with	Repair ceramic tiles.
Pollokshaws Rd.	business with unified design. Signage	ceramic tiles, some missing at close entrance.	
Close entry	on original fascia. Retractable	Exemplar design.	
no.1047	canopies.		
1053-59	1053 – Recessed entrance door. LHS.	Signboard mounted below fascia & breaks original line of	Remove surface
Pollokshaws Rd.	Piers formed either side.	window transom. White decoration tired. Poor appearance,	mounted services from
Entry to hall at		easily improved. Entrance at 1055- poor signage &	fascia & repair. Co-
rear no. 1055.		inappropriate door design.	ordinate signage &
Close entry no.	1059 – take-away food outlet. Flushed	Surface mounted services on original fascia. Signboard with	decoration.
1057	frontage. Aluminium door & window.	neon letters mounted below. Refuse bins outside. Appearance	
		poor.	
1061-67	1061- "Betfred" – Aluminium framed	Bold signage above blank downstand- breaks line of original	Reinstate line of original
Pollokshaws Rd.	replacement faceted frontage with	fascia & transom.	fascia & transom & co-
Close entry no.	central double doors.		ordinate decoration to
1065	1063 – Charity shop – Flushed	Proportions almost as original. Solid piers created where door	unify appearance.
	frontage. Painted white.	brought forward. Appearance poor. Easily improved.	
	1067 – Pharmacy - Flushed frontage.	Solid piers created where door brought forward & relocated	
	Stained timber with central metal	from RHS. Original fascia extant. Layers of signage built up.	
	door.	Could be easily improved.	

**Buildings:** 1069-1093 Pollokshaws Road (odd nos.)

Description: Row of three 3-storey yellow sandstone, flat fronted tenements. Bay at south end of row steps forward & has additional attic storey. Two

close entries and eight shopfronts. The original simple, projecting timber cornice and fascia, between the stonework & the shopfronts, survives in sections and could easily be copied and restored. Original shopfronts were set in slender timber frames with structural columns behind the glass or at the recessed entrances. Historical photos (Glasgow City Archives-Virtual Mitchell) show that windows had a

continuous transom in line with the close fanlight and some shopsfronts had curved glass at the entrance.

Significance: Medium - Unlisted buildings of merit. Located between two junctions. Photographic evidence of original design.

Building address	Shopfront description	Condition	Recommendations
1069-75	No. 1069 –Hairdresser. Replacement,	Original cornice & brackets extant, but cornice in need of	Once elegant shopfronts.
Pollokshaws Rd.	flushed aluminium frontage. Door LHS,	repair - sagging & separating from flashing. Signboard fixed	Signage & colour scheme
Close entry	internal boxed column at centre of	over fascia, extending to transom line.	should be uniform.
no.1071	window.		Excess signage should be
	No. 1073/75 –charity shop.	Timber cornice removed, leaving poor flashing detail at	removed.
	Replacement aluminium frontage.	junction with stonework. Signboard full depth of original fascia	The original timber
	Recessed door with 2 internal boxed	& upper windows combined.	cornice and fascia should
	columns.		be repaired or replaced
1079-89	4 shopfronts, 2 either side of close	Section of timber cornice & fascia extant at 1083-87. In need	where missing.
Pollokshaws Rd.	entry. All replacement aluminium	of repair at exposed ends. Missing elsewhere. Signage boards	External shutter boxes
Close entry	framed frontages.	are built out, of varying depths & colour & with external	should be removed.
no.1085		shutter boxes. 1083 appearance very poor.	
1091-93	2 shopfronts adjacent to lane access.	No projecting cornice. Fascias on different planes. 1091 has	
Pollokshaws Rd.	1093 is "to let". Shutters closed.	canted fascia with external shutter boxes & replacement	
	Archive drawings show symmetrical	façade. Fascia may be extant below signboard. Stallrisers vary	
	frontages with doors at centre.	in height. Appearance poor.	

#### Area 2

**Buildings:** 1097-1129 Pollokshaws Road (odd nos.)

Description: Row of flat fronted, C19 3-storey yellow sandstone tenements. Four buildings; one of higher proportions followed by three lower buildings,

having a continuous eaves line, but shopfronts step down hill towards Shawlands Cross. Lower buildings are simple in design and probably of an earlier date. This row gives continuity to the street and forms an important part of the urban grain. The last block, nos. 1125-19, is in a prominent location facing Moss-side Rd. on Shawlands Cross. Generally, the proportions of the original shopfronts has been lost and the

proliferation of signage and external shutters detracts from the overall appearance.

Significance: medium – unlisted buildings of merit in prominent location. Nos.1125-29 is located opposite Moss-side Rd. at Shawlands Cross.

Building address	Shop front description	Condition	Recommendations
1097-1105	1097 – Georgic bar – occupies	Traditional pub frontage. Appropriate scale. Dark-red décor. Fair	Remove external shutter
Pollokshaws Rd	RHS of close. Central entrance.	condition.	boxes. Co-ordinate signage.
close entry no.	1103 & 1105- 2 small units on	Proportions altered by deep, bold signboards & external shutter	
1101	RHS of Close. Adjacent doors at centre.	boxes. Original cornice & fascia below. Dark décor is good.	
1109-1113	3 units- 1 café & 2 vacant units	No original features visible. All units have deep signboards with	3 of 8 units vacant. Boxed
Pollokshaws Rd	with shutters down.	shutters below. Café (1109a) in fair condition. No.1113 (vacant	out, brightly coloured
close entry no		unit -Credit Union)- signage boxed out from fascia with external	signage & additional
1111		shutter boxes below. Very poor appearance.	projecting signs are very
1115-1121	3 units -1 vacant unit, a	All faced in different materials in different colours. Nos.1115 &	unsightly. Remove all boxed
Pollokshaws Rd	newsagent & fishmonger.	1117- signage boxed out from fascia & additional projecting signs	out signage & external
close entry no		- very poor appearance. No.1121 (fishmonger)- flat frontage.	shutter boxes, & restore
1119		Original cornice visible. Fair appearance.	proportions. Encourage co-
1125-1129	2 units – barbers & beauty salon.	Visible fragments of original details at Close entry. Aluminium	ordinated finishes & colour
Pollokshaws Rd	Prominent location opposite	framed frontages, deep signage boxed out from fascia &	schemes. Discourage
close entry no	Moss-side Rd.	concealing external shutters. Signage also covering stone piers.	coverings over stone piers.
1127		No.1125 is very poor. Should be improved to sit better with 1129	
		as a minimum.	

**Buildings:** 1133-1149 Pollokshaws Road (odd nos.)

Description: Block comprises 3 buildings of different periods, making an interesting composition on Shawlands Cross. First is C19 3-storey, flat fronted,

yellow sandstone separated by a lane from the building described above. Second is early-C19 or older, small 2-storey, 3-bay façade with

painted finish & hipped roof. Third is late-C19, 3-storey, red-sandstone former bank building, with shallow bay windows.

Significance: Medium – unlisted buildings of merit prominently located on Shawlands Cross, opposite Shawlands Cross Church.

Building address	Shop front description	Condition	Recommendations
1133-1143	4 units – food take-away, charity shop,	Original projecting timber cornice extant above	Repair cornice & flashing. Co-
Pollokshaws Rd	Denture repairs & a boutique with shutters	signage. All have deep, plumb (rather than canted)	ordinate signage & décor at
close entry no	closed on inspection (for sale).	fascia signage concealing shutters with shutter	1133 & 35 in this prominent
1137, Pend entry	All have flushed frontages except no.1139	frame surface mounted at each side. Signage at	location. Removal external
no.1141	which has recessed entry.	no.1133 is very bold. 3 units have dark décor, 1 is	shutters.
		painted white. Cornice in poor condition.	
1145-47	1 unit -Charity shop. Bold red frontage with	Deep, plumb fascia concealing shutters (?) divides	Remove deep fascia & reveal
Pollokshaws Rd	recessed central entrance.	building façade in two. Bright red gloss shopfront	building proportions. Signage to
		sits forward of stone piers. Not in-keeping with	be in-keeping with building
		historic building.	scale.
1149 Pollokshaws	1 unit -Former bank frontage extant.	Form of frontage largely unchanged except -white	Darker decor on the windows
Rd	Moulded stone cornice over fascia with grey	fascia, white painted windows & advertising on	would improve appearance.
	granite frontage. Now a dental practice.	glass. Condition good.	
	Entrance on corner with Skirving St.		

Building(s): The Granary, Crossmyloof Mansions - 1155 Pollokshaws Rd & 10-12 Kilmarnock Rd, extended to include 1165 Pollokshaws Rd. & 14

Kilmarnock Rd.

Description: Crossmyloof Mansions - 4-storey, C19 yellow sandstone tenement with (later) flat-roofed "high-back" or drying area, located on gusset site

at Shawlands Cross. The Granary bar & restaurant occupies the whole of the ground floor. Premises extended into ground floor of adjacent 3-storey tenement on Pollokshaws Rd. (rusticated stone façade painted to match) and 1-storey shop units on Kilmarnock Rd. There are pavement lights to a basement on Pollokshaws Rd. The public area is located at the Cross, expressed by large windows, with a service area beyond. The main entrance is at 1155 Pollokshaws Rd. The solid double doors at the prominent corner are kept closed. Service areas are expressed by blank facade with air vents on Kilmarnock Rd. The fascia is continuous across the top of the whole of the premises. It is altered from the principal to include downlighting. The signess of decay are in keeping.

from the original to include downlighting. The signage & décor are in-keeping.

Significance: High - Listed in category B. Prominent location at Shawlands Cross on gusset junction of Kilmarnock Rd & Pollokshaws Rd

Condition: Fair -Décor is a little tired. Some graffiti on Kilmarnock Rd frontage. Flashing above cornice on Kilmarnock Rd. in need of repair.

Comments: Repair flashing. Refresh decor. Re-opening the door at the Cross to allow views into the premises would add interest at the corner.

AREA 2 Location adjacent to Shawlands Cross

Building(s): 1169-1171 Pollokshaws Rd. (odd nos.)

Description: 3-storey, C19 yellow sandstone tenement with rusticated stone base, painted finish. No shopfront originally. Ground floor access to two

businesses, each has painted the wall a different tone of off-white. No.1169 – entrance to beauty salon with aluminium door, external roller shutter and signage fixed above door and hanging perpendicular to wall. No.1171 – café with external shutter boxes over each opening and

signage fixed above to face of stone.

Significance: Low – Located opposite Shawlands Old Parish Church, but at the end of the commercial area.

Condition: Fair – signage & shutters are poor.

Comments: Remove external roller shutters; improve signage; remove paint from stone or replace it with a breathable coating in colour to match stone.

**Building(s):** 5-17 Skirving Street (odd nos.)

Description: 4 commercial units in ground floor of 3 buildings. No.5- charity shop within the former bank building. Blank fascia is in need of repair. Deep

signage & external shutter box below. Nos. 7 & 11- Oddbins & deli below red sandstone tenement. Nos.13-17 - 1-storey brick building (now a café), built in front of smart 2-storey, yellow sandstone building set back from the street, (now a Mexican restaurant). Signage at first floor

is not in-keeping & partially obscures a window.

Significance: Low – Unlisted buildings of merit, contributing to the area character, located off the main road.

Condition: No.5 is poor; No.15- restaurant signage is too bold, graffiti at first floor.

Comments: Repair fascia at No.5 & remove external shutters. Remove graffiti at No.15 and control restaurant signage.





S.E. side of Pollokshaws Rd viewed from Shawlands Cross

Vacant units & signage @ 1113-1117







1133-47 Pollokshaws Rd. open views from Shawlands Cross - 1939 (Glasgow City Archives- ref.C6713) & 2015

Signage viewed from no.1125 looking north, showing cumulative effect of alterations & additions.

# Fig. 6 AREA 2 Priorities

- 1109-1147 Pollokshaws Rd. prominent end of row of buildings stepping up the hill. Several vacant units. Poorest condition in Area 1. Remove roller shutters & layers of signage back to simple fascia of original proportions. Co-ordinate décor.
- 1045-67 Pollokshaws Rd. Complete restoration of original shop proportions & signage begun @ 1045-51; co-ordinate décor for shops & close entrances. Catalyst for other decorative schemes e.g. 1069-93 & 1082-1102 Pollokshaws Rd.





1045-67 Pollokshaws Rd. - 1939 (Glasgow City Archives-ref.C6688) & 2015

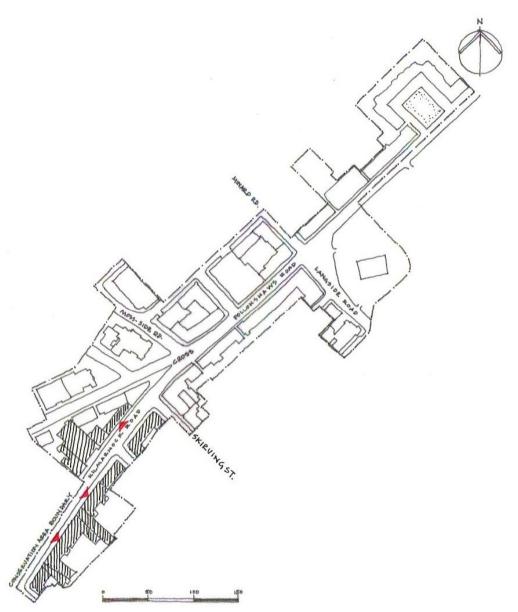


Fig. 7 SHAWLANDS CROSS CONSERVATION AREA – **Area 3** shown hatched. Arrows locate priority buildings recommended at the end of this section.

#### AREA 3 Kilmarnock Road from Shawlands Cross to Walton Street

**Building(s):** 1-21 Kilmarnock Road (odd nos)

Description: Row of 3-storey, C19 yellow sandstone tenements between Skirving St & Mount Stuart St. The classical details at the skyline create one

composition from three buildings. It's very likely that the original shopfronts conformed to a uniform design. There is a continuous moulded, timber cornice above the fascia as far as the Clydesdale Bank, where is has been cut and replaced with a granite frontage. The flashing above is in need of repair. The original canted fascia is mostly covered with layers of signage, except at the close entrance-where a hand-painted number is visible. There is one close entrance & eight shop units. The masonry piers between units have been covered in a

variety of materials.

Significance: Low - Unlisted building of merit, contributing to the area character.

Building address	Shopfront description	Condition	Notes
1-5 Kilmarnock Rd	3 units – Food take-away, shoe repairs &	Deep signboards fixed plumb over fascia & extended	Missing materials should
close entry in	"cheque centre"- all with replacement metal	over piers with no break between units. Large glazed	be replaced & timber
Skirving St.	framed frontages. No.1 is entered on the	area helps balance proportions. Décor predominately	cornice repaired, as
	corner. Bus stop in front of no.5	blue with white sign at centreFair	required. Signage &
7-15 Kilmarnock Rd	3 units – pharmacy, electronic cigarettes,	Deep signboards don't line through. Part of canted	colour scheme should be
close entry no.11; 1	bakery – All with metal framed frontages.	fascia visible in nos. 13&15 Fair.	unified.
large unit LHS, 1	Nos.7/9 & 15- both have ceramic tile finish &		
small & 1 large unit	recessed entrances.		
RHS			
17-21 Kilmarnock Rd	No.17 –vacant unit-white ceramic tile finish	Timber cornice and fascia extant but crudely cut back	
close entry in Mount	with metal framed doors & window.	& patched at no.19. Signboard fixed plumb partially	
Stuart St.		covering fascia. Ceramic tiles missing Poor	
	No.19/21-Clydesdale Bank-replacement mid-	Crude junction where cornice removed. Good quality	
	C20 pink granite façade. Timber cornice &	materials. Well maintained Good	
	fascia removed. Entrance on corner.		

AREA 3 Pavement recently resurfaced in stone from Mount Stuart St. to Walton St.

**Building(s):** 29-43 Kilmarnock Road (odd nos)

Description: Row of 3-storey, C19 yellow sandstone tenements with projecting bay windows, built to similar design. Nos. 29-43 have wide, shallow bays

and simple close entrances. Early 20<sup>th</sup> century images (Glasgow City Archives - Virtual Mitchell) show well-proportioned shopfronts of simple design. There is a continuous cornice with some decorative brackets remaining between units. Sections of the canted fascia above

the shops has been removed and replaced with deeper vertical signboards, interrupting the profile.

Significance: Low – unlisted building of merit, contributing to the area character.

Building address	Shopfront description	Condition	Notes
29-33 Kilmarnock Rd	Bank occupies nos. 29 & 31. Flushed	Good proportion. Sharp cornice profile, canted fascia &	Check condition of
corner of Mount	glazed façade with granite base. Entrance	large glazed area retained. Tidy frontage. – Good.	cornice and flashing &
Stuart St. close entry	on corner. Original proportions retained.		repair as required.
no 33	Close entry has modern door & fanlight.	Close entrance could be improved.	Remove redundant
35-43 Kilmarnock Rd	4 units – café, IT repairs, food take-away	Fascia built out at no.35 with awning below. Canted fascia	services. Co-ordinate
close entry no 39	& health shop. Nos. 35, 37 & 41 have	removed & cornice altered over nos. 37- 43. Cornice	signage. Discourage
	replacement metal framed frontages. No.	brackets extant at nos. 41 &43. Alterations have	signage on glass.
	43 is replaced in timber with domestic	interrupted continuous line of cornice & fascia. Condition	Encourage uniform
	scale entrance door. All have increased	of cornice & (felt) flashing should be checked. Additional	design of close doors &
	fascia depth & reduced glazed area.	signage printed on glass at nos.37 &41. Individual	fanlights.
		treatment of signage detracts from overall appearance. –	
		fair to poor	

**Building(s):** 45-57 Kilmarnock Road (odd nos)

Description: Row of 3-storey, C19 yellow sandstone tenements with projecting bay windows, built to similar design. From no. 45 to 59, shop fronts step

forward where projecting bays above increase in depth. Early 20<sup>th</sup> century images (Glasgow City Archives-Virtual Mitchell) show a row of elegant shopfronts with decorative timber details and recessed doorways to a repetitive design. The shops and close entrances sat below a continuous fascia with console brackets between units containing signage in uniform lettering. These have typically been replaced with metal framed frontages & deep fascia boards, but evidence survives of a continuous moulded cornice with classical details above a canted fascia with decorative end brackets. Arched openings and decorative timber details survive at the close entrances. Boxed out mullions between units may conceal original details. The depth of signage has been increased to the line of the original shop window transom,

altering the proportions.

Significance: Medium – good quality original design, photo evidence c1930s, some details extant.

Building address	Shopfront description	Condition	Recommendations
45-49 Kilmarnock Rd	No 45- hairdresser. Unit steps forward	Cornice & fascia little altered-signage added below fascia &	Original uniformity has
close entry no 47	approx.1m. Timber framed shopfront	double door added on street line, fanlight boarded over.	been lost by the
	with original details, white decor.	Redecoration required. Easily improved/restored fair	individual treatment of
	Structural column visible at corner.		the facades.
	Nos 45a &49 -newsagent & café.	Cornice with classical details extant at nos.45a &49, but	Remove layers of signage
	Replacement facades. No 45a- Blue &	obscured by layers of signage & services mounted over	& services to expose
	yellow decor & flush metal door; No 49-	fascia. Signage on glass detracts from appearance. No.49	original details over shop
	stained ply boxed mullions with	comprised of several materials. –poor	windows. Repair cornice
	recessed metal doors.		& flashing, as required.
	Close entry no.47 – original decorative	Security camera, signage & other services surface mounted	Restore details &
	timber details extant around opening.	on ply board fixed over arch. Timber baluster LHS recessed	reinstate uniform signage
	Arch above & RHS pilaster boarded	between built out fascia boards. Repair reqd. at base of	and decoration.
	over. Modern door & fanlight added.	timber pilaster LHS. Details on RHS may survive under boxed	Restore close entrances
		out mullion poor	and install matching
51-57 Kilmarnock Rd	3 units- coffee shop, opticians &	No original details visible. Fascia & mulllions built out at 51	doors.
Close entry no 55	building society (2 units combined).	& 53, possibly retaining details below. No53 has external	
	Flushed frontages. Metal framed units	roller shutter. No. 57 - Replacement stone-clad façade	
	between mullions.	retains the cornice only with lead flashing. Better	
		proportions. – fair to poor	
	Close entry no.55-original arched	Front face of pilasters either side covered. LHS may survive.	
	opening & details extant.	Modern door & fanlight added fair	

**Building:** 61 Kilmarnock Rd (former Woolworth & Co)

Description: 2-storey building with one wide frontage commercial unit (vacant) below a blank, roughcast wall. Former early-C20 Woolworth & Co. with

Art Deco style stone façade with stepped parapet above the shop. 5 windows were symmetrically arranged on first floor. There was a deep fascia over the shop with decorative brackets either side. The glass shopfronts were set back with 2 recessed doors between 3 display windows. (source: Glasgow City Archives ref: C6318). Building occupies the whole depth of the site. None of the original architectural features are now visible. The top courses of the parapet have been removed, the windows have been blocked and the stone facade has been flushed and covered in roughcast. The original dressed stone can be seen on the exposed party-wall to the south. Original fascia & details have been removed & replaced with a signboard at a lower level to line through with No.63. There is no cornice detail above the

fascia. Central entrance with bi-fold doors either side. Red & white décor.

Condition: Building is much altered & appearance is very poor. There is a gutter behind the parapet and the wallhead flashing is in need of repair. The

unit is now "to let".

Significance: Low in current state – more information required.

Comments: The building has a negative impact on the street. Investigation is recommended to determine the nature of alterations made to the façade

and the first floor accommodation, and whether this is reversible. Signage should be replaced and shopfront repaired and redecorated.

**Building: 63-75 Kilmarnock Rd** (odd nos)

Description: Row of one storey, early C20 purpose-built shops. Symmertical gables, each with an arched window, are positioned to line through with the

hipped end of the pitched roof. An open balustrade sits above a stone moulded cornice, linking the architectural elements. There is a solid panel with an arched profile at the centre. The gables have a plastered finish. The moulded stone on top of the balustrade is damaged and in need of repair. The cornice and masonry above is painted white and badly stained. Glasgow City Archive images from 1939 show a contemporary uniform shop design (probably replacing the original) with all signage in a single font, mounted on a continuous black fascia across the top of the shops. The entrance doors are recessed and there is a continuous stallriser of dark coloured granite (?). This uniformity has been lost by the individual treatment of the replacement facades. There are now 6 units, 1 large and 5 small. 3 of the 6 are eating

places. 2 have tables on the pavement (recently re-surfaced in stone).

Condition: Façade at No. 63 (2 units combined) has retained good proportions & décor. Remains of a dark-blue granite tiles on mulllions. No. 67 was

being refitted at time of survey. Nos. 69-73 have individual replacement frontages, décor & signboards that do not quite line through.

No.75 has altered proportions by extending signboard to line of window transom. Each facade is tidy. The stonework above is in need of

maintenance & repair. Services are surface mounted on the gables. - Fair

Significance: Medium – individual design of character. Historical photo evidence of co-ordinated 1930s design (replacing original).

Comments: A unified shopfront design would be simple to achieve & could contribute much to the street. It should be done in conjunction with repairs

to the stonework above.

**Building:** 77-85 Kilmarnock Rd (odd nos)

Description: 3-storey, C19 yellow sandstone tenement with projecting bay windows at each end with decorative stone cornice at eaves. Shops units are

built forward in line with projecting end bays and lining through with one-storey shop units adjacent, the profiled stone cornice of which continues half way along the façade, where it stops at close no.83. Glasgow City Archive images c1939 show the unified shop front design for nos. 63-75 continued into this block. Remnants of the 1930s black & chrome finishes can be seen above and on RHS of close door at no.83. Close entry has mis-matched elements: fanlight with arched astragal, undersized door with & solid panel to LHS. All in need of

maintenance.

Significance: Medium – unlisted building of merit in busy shopping area.

Building address	Shopfront description	Condition	Recommendations
77&79 Kilmarnock	No.77-Ladbrooks. Large unit with recessed	No.77 – Good proportions. Views of interior blocked.	Unify fascia & signage full
Rd	entry. Retains proportions. No.79 –	No.79- oversized signboard surface mounted on mullions	length of building. Repair
	convenience store. Metal replacement	either side. Printing on glass. Nothing consistent. Open	cornice & inspect fabric
	façade, deep signboard with bold colours.	joints in stone cornice fair	where removed.
85 Kilmarnock Rd	Italian restaurant – white marble Deco	No cornice. Appears to have been removed, inspection	Close entry should be
	style façade. Steps up to wide central	reqd. to confirm. Oversized signboard with felt flashing	repaired & redecorated.
	entrance. Pavement seating.	over (?). Awnings below. Well maintainedFair	

Building: 87 Kilmarnock Rd

Description: 2-storey building, occupying full depth of slender site between tenements. Modern façade in timber, contrasting with stone tenements.

Solid upper floor with bold signage, bi-fold doors at ground floor to bar-restaurant with pavement seating.

Condition: Fair Significance: Low

**Building(s):** 89 -101 Kilmarnock Rd (odd nos)

Description: 4-storey, C19 yellow sandstone tenement with projecting bay windows & corner bay at Walton St. 3 large units, each has been designed

independently. It appears that the ground floor was originally residential and the shops are a later alteration. Middle unit appears to bridge

across the party wall of 2 tenements. Close entrances at 95 Kilmarnock Rd. & 3 Walton St. New stone pavement extends to Walton St.

Significance: Low- unlisted building of merit at edge of conservation area.

Shopfront description	Condition	Recommendations
89 Kilmarnock Rd- shop front built out below bay	Vegetation in gutter. In need of maintenance & repair	On approach to conservation area
window. Returns at close. External shutters. Vacant.	Poor	from south-west. Remove excessive
97-99 Kilmarnock Rd – Restaurant/take away. 2 units	External box shutter over door at 97. Untidy surface	signage & external shutter box at 97-
combined. 2 doors, 1 enlarged & 1 bay window. Ceramic	mounted services at frieze. Signage mounted on all	99. Encourage improved maintenance
tiles added to stonework including bay window.	surfaces, including windows & large perpendicular sign	regime & some co-ordination in
	fixed to bay. – very poor	appearance.
101 Kilmarnock Rd- Apollo Blinds. Corner shop. Canted	Fascia added. Felt flashing over. No projecting cornice.	
fascia, signage below. Metal framed windows & door.	No opening lights in windows. Masonry piers with	
Corner entrance.	rendered finish fair	

# AREA 3 - even numbers south from Shawlands Cross

**Building(s):** 16-40 Kilmarnock Rd (even nos)

Description: Row of 1 & 2-storey commercial units. Nos. 14-22 sit below the first floor drying area, or "high-back", serving Crossmyloof Mansions, with

original railing extant. No. 14 is now part of the Granary bar. Nos. 24-34 are 2-storey shops with plain flush frontage, rendered parapet and band of horizontal windows at first floor, creating a mid-C20 appearance. However, Glasgow City Archive images c1939 show nos. 14-34 were originally a row of elegant late-C19/early C20 shops unified by a continuous fascia with signage, tall windows and recessed entrance doors. The height of the 2-storey shops corresponded with the eaves of an earlier stone villa (demolished) on the site of nos. 36-40. This site is now occupied by a mid-C20, 2-storey, framed building of 3 bays, each with a shop unit. The parapet is lower than no. 24-34 and there is a gap between the buildings at nos.34 &36. Generally, the buildings have been poorly maintained and suffered piecemeal alterations,

resulting in a "patchwork" appearance that has a negative impact on the approach to the Cross.

Significance: Medium - little architectural merit in current state, but improvement would improve approach to Shawlands Cross. – Priority for Council

Building address	Shopfront description	Condition	Recommendations
16-22 Kilmarnock Rd.	4 units -1 vacant, newsagent, food	Flat roof over with original railings. Individual	Parapet & flashings should be
Single storey with	take-away & mobile phone shop. All	signboards built out from face, some concealing	checked & repaired full length.
tenement backcourt	with replacement shop fronts & bold	external shutters, flashings over are not continuous.	Redundant services should be
on roof.	signage. No original details visible.	Surface mounted external lighting & services.	removed. Fascia should be
		Appearance & condition – very poor	continuous depth across each
24-34 Kilmarnock Rd.	4 units – 2 single & 2 double units.	Parapet altered, rendered finish in poor condition.	building. Signage & lighting should
2-storey shops.	No.24 –greengrocer; no.26-beauty	Mid-C20 1 <sup>st</sup> floor windows extant nos. 30-34. Others	be unified & controlled. Any
C19, altered mid-	salon; no.28-30 is vacant; no.32-34-	replaced. Cornice cut & stallriser reduced at no.26.	surviving original details below
C20.	money lender. All first floors vacant	Signboards built out at nos.24 &26, concealing	finishes should be recorded.
	except no.26. Original facade altered	external roller shutters. Flashings poor. Fragment of	Redecoration should be co-
	in mid-C20 & windows replaced. Units	decorative timber detail at fascia no.34, south edge.	ordinated.
	independently treated. Signboards out	Appearance & condition – very poor	
	of alignment.		
36-40 Kilmarnock Rd.	3 units of equal size- travel agent & 2	First floor rendered frame & regular timber window	Check parapet & flashings full
2-storey shops mid-	charity shops. First floors	pattern as original. In need of maintenance. Graffiti on	length. Repair first floor windows.
C20 building	vacant/storage. Replacement metal	parapet. Deep signboards built out forward of building	Remove large signboards & reinstate
	framed shop fronts. Deep plan.	frame, flashing over. Individual shop front divisions	fascia of appropriate proportions
		out of alignment with first floor.	with unified signage. Redecoration
			should be co-ordinated.

**Building:** 

42-46 Kilmarnock Rd (even nos) – Former White Elephant Cinema. Rear gable on Pollokshaws Rd.

Description:

3-storey building with mid-C20 façade occupying whole site between Kilmarnock Rd & Pollokshaws Rd. Previously the White Elephant Cinema (c1927), the original complex included the ballroom and car park at no.54 adjacent. The original stone façade was altered when the building was converted to shops in 1960s (source: <a href="www.scottishcinemas.org.uk">www.scottishcinemas.org.uk</a>). The basic symmetry of 3 bays supported on columns with recessed ground floor, flanked by stair towers, remains from the original building. The parapet and ground floor have been altered and the main façade has been re-clad in grey stone and mosaic tiles in mid-C20 style. The building is now vacant, with the exception of one shop unit. A deep blank fascia (painted ply?) runs the length of the building and continues across the façade of the adjacent building, no. 48-54 (c1960s alterations). No.42 has been boarded up with ply for some time with a roller shutter over the door. There are 2 shop units: – no.44 is a clothing retailer; no.46 is vacant and concealed behind roller shutters. The soffit of the "colonnade" is finished in timber boarding & the pavement is mosaic tiles. The colonnade and finishes extend into the ground floor of the adjacent building at no.48 (c1960s alterations). Note: Rear elevation on Pollokshaws Rd. sits back from the building line at an angle with parking area in front, between two sandstone tenements and opposite Shawlands Old Parish Church & hall (Listed building). It is a rendered gable with one row of barred windows at first floor level. No attempt is made to relate to the urban form or the architecture of the adjacent buildings.

Condition:

The building appears to have been vacant for some time (except no.44) and the general appearance of the "colonnade" is poor. The 1960s finishes are robust and could be much improved by cleaning and general maintenance if the building was brought back into use.

Significance:

Low/Medium - Building has an interesting social history. More information will be required on the history and interiors to confirm its significance. (some finishes may survive behind partitions & suspended ceilings). The colonnade has a negative impact on Kilmarnock Rd & the rear gable has a negative impact on Pollokshaws Rd.

Comments:

The important issues here are around fining a new use for the vacant building. The "colonnade" could be improved by cleaning the finishes and co-ordinating the signage & lighting. Further information should be sought on the history and building fabric before future alterations are carried out. Currently having a negative impact on the street.

**Building:** 

48-54 Kilmarnock Rd (even nos) – former ballroom with car park

Description:

2-storey, early-C20 building (c1927) with yellow sandstone façade to upper floor with Classical details. 4 bays each have 2 large windows with pilasters between. Former ballroom with carpark entrance/exit below in two central bays. Glasgow City Archive image c1939 shows a row of double doors opening on to a cantilevered balcony at first floor, steel columns supporting the building at the car park entrance and a "Deco" style canopy over a double entrance at south end (no.54). The balcony has been removed and the doors are now windows. The upper floor, latterly a nightclub, is now "to let". A deep fascia (ply), continuous with no.42 adjacent, runs below a moulded stone cornice. Each of the 4 ground floor bays is treated differently. There are 2 shop units at nos.48-50, a vehicle access and a wide, recessed entrance to the first floor at no.54. Both shops have replacement frontages & bold signboards. No.48 is set back in line with the adjacent colonnade and no.50 steps forward to the building line. A crudely built canopy projects over the 2 bays at south end (no.54).

Condition: The building has a handsome upper floor, in spite of the later alterations. A variety of ill-matched finishing materials have been used below

the stone cornice. The fascia board and canopy are formed in inferior materials and are in poor condition. Sections of flashing above the fascia are missing. There is graffiti on the wall into the car park and bills have been posted on the walls. Steps & entrance plat at no.54 in

need of repair. (There were rubbish bags stacked in this entrance on the day of the survey).

Significance: Medium – unlisted building of merit with interesting local social history.

Comments: Fascia board & canopy should be removed & fabric repairs carried out as required. Pallet of materials, uniform signage, lighting & décor

should be agreed for the whole facade. Further information should be sought on the history and building fabric before future alterations

are carried out.





16-34 Kilmarnock Rd. 1939 (Glasgow City Archive-Ref. C6337&8) & 2015 showing dominance of patchwork signage







45-57 Kilmarnock Rd. 2015 showing extant details @ nos.45 & 55 and in 1939 (Glasgow City Archive-Ref. C6324)



Details @ close no. 47

# Fig. 8 AREA 3 - Priorities

- 16-34 Kilmarnock Rd.-Poorest appearance.
  Control signage & promote co-ordinated design. Attached to Listed building at Cross
- 45-57 Kilmarnock Rd.— Reveal & repair details of original elegant shops, restore proportions & co-ordinated signage.
- 63-75 Kilmarnock Rd.-Opportunity to create a new unified design.








61 Kilmarnock Rd. 1939 (Glasgow City Archive-ref. C6318); 71-73 Kilmarnock Rd. 2015 & 1939 (GCA- C6326)



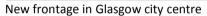



Original form & proportions conserved & repaired in Argyle St



Original proportions conserved & adapted in Argyle St

# Fig. 9 Precendents

Examples of improved shopfronts in Glasgow City centre, Argyle Street at Finnieston & Hynland Rd.



Frontage in-keeping with C18 building



Conserve "as found" approach in Argyle St.



Simple frontage, restored proportions.



Corner detail, Hyndland Rd.